

Ship Feb. 10

Work Order ID 141265

141265

Page 1

Wednesday, February 03, 2016 9:48:41 AM

Item ID: DSI 9733-011 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Skidtube Repair
 Start Date: 2/3/2016 Start Qty: 30.00 *30* Cust Item ID:
 Required Date: 2/5/2016 Req'd Qty: 30.00 *30* Customer:
 Reference:

Approvals: Process Plan: HA Date: 16-2-3 Tooling: Date: Run Start *NR1*
 QC: Date: SPC (Y/N): Date: Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
DSI 9733	A								
100	Document Control	0.00							
100	DOCUMENT CONTROL								
DC	Memo	0.00							
Doc.Control -USB or Paperwork	Photocopy bluefile & type labels per PPP DSI9733-011 CHG001								
110	Pick Kit	0.00							
110									
Packaging	Memo	0.00							
Packaging									
120	QC4- 100% Inspect kits for completeness	0.00							
120									
QC	Memo	0.02							
Quality Control									

DAS
6
9-89

mha

DAS
38
9-89

16-02-10

30
FEB 05 2016

DAS
8
9-89

DAS 28 9-89
DAS 27 9-89

DAS
38
9-89

16-02-10

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition		Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐			

Work Order ID 141265***141265***

Page 2

Wednesday, February 03, 2016 9:48:41 AM

Item ID: DSI 9733-011 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Skidtube Repair
Start Date: 2/3/2016 Start Qty: 30.00 ***30*** Cust Item ID:
Required Date: 2/5/2016 Req'd Qty: 30.00 ***30*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130	Packaging	0.00							
130									
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPP DSI9733-011 Location:								
140	QC21- Final Inspection - Work Order Release	0.00							
140									
QC	Memo	0.05							
Quality Control									

Sold
BAS
27
9-89
FEB 10 2016

MCJ FEB 10 2016

MCJ FEB 10 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QS1042) Approval	
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____							
Misidentified ☐	☐ Past Due								

Picklist Print

Wednesday, February 03, 2016 9:48:54 AM

Page 1

Work Order ID: 141265

141265

Parent Item: DSI 9733-011

DSI 9733-011

Parent Item Name: Skidtube Repair

Start Date: 2/3/2016

Required Date: 2/5/2016

Start Qty: 30.00

Required Qty: 30.00

Comments: IPP REV:A 16.02.03 NEW ISSUE DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
AN5C7A		Purchased	No				Each	311.0000	10	300			DAS 6 9-89
AN5C7A	DAS								**			134181	DAS
BOLT	38												28
	9-89												9-89

Location	Loc Qty	Loc Code
FG	2	
19185	2	
over003	150	
m131320	150	
ST338	159	
m131139	7	
m132123	52	
m132930	100	

MS20601-AD4W4		Purchased	No				Each	229.0000	12	360			DAS 6 9-89
MS20601-AD4W4	DAS								**			134181	DAS
Rivet	38												28
	9-89												9-89

Location	Loc Qty	Loc Code
ST307	229	
113064	32	
113749	197	

MS20601-AD4W9		Purchased	No				Each	10.0000	8	240			DAS 6 9-89
MS20601-AD4W9	DAS								**			98X 134181	DAS
RIVET	38											134215X142	28
	9-89												9-89

Location	Loc Qty	Loc Code
Mezz	10	
19191	10	

FEB 05 2016

FEB 10 2016

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong				
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions				
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance				
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect				
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing				
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved				
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing				
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish				
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread				
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence				
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____							
Misidentified ☐	☐ Past Due								

Picklist Print

Wednesday, February 03, 2016 9:48:54 AM

Work Order ID: 141265

141265

Parent Item: DSI 9733-011

DSI 9733-011

Parent Item Name: Skidtube Repair

Start Date: 2/3/2016

Required Date: 2/5/2016

Start Qty: 30.00

Required Qty: 30.00

MS21075L5

Purchased

No

Each

233.0000

10 300

MS21075L5

**

134/81

DAS

Nut Plate

DAS

38

9-89

8

9-89

Location

Loc Qty

Loc Code

CCK007

8

DAS

m133577

8

28

GA

175

9-89

m134026

175

ST298

50

m133498

50

NAS1149C0532R

Purchased

No

Each

241.0000

10 300

NAS1149C0532R

**

134/81

WASHER

DAS

38

9-89

DAS

8

9-89

Location

Loc Qty

Loc Code

GA

60

FEB 05 2016

116513

60

ST271

181

DAS

m133031

181

27

9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐			

DART SERVICE INSTRUCTION

TO AMEND INSTALLATION INSTRUCTIONS IN D412-742 REV. E AND
INSTRUCTIONS FOR CONTINUED AIRWORTHINESS ICA-D412-742 REV. 4

REF FAA STC: SR01583SE
REF CANADIAN STC: SH05-37
REF EASA STC: EASA.IM.R.S.00126

1.0 PURPOSE

The purpose of this DART Service Instruction is to provide a repair procedure to replace spinning AELS-1032 inserts with MS21075L5 Floating Nut Plates on D412-742-011/-013 Float Skid tubes in locations where the D3391-013/-023 Mid Tube Assembly overlaps the D3391-015/-025 Aft Tube Assembly as shown in Figure 1.

This modification has been incorporated into D412-742-011 @ CHG008 and D412-742-013 @ CHG008

2.0 INSTALLATION

Note 1: Disassembly of the D3391-015/-025 Aft Tube Assembly from the D3391-013/-023 Mid Tube Assembly is required prior to completion of this repair. Disassemble in accordance with ICA-D12-742.

Note 2: When drilling holes for the Floating Nut Plate, DART recommendation is to use a Nut Plate Drill Jig to ensure drilled holes are well aligned and square for ease of installation.

- 2.1 Drill out AELS-1032 Inserts (Qty 10) located in D3391-015/-025 Aft Tube Assembly using a $\varnothing 0.375$ drill in locations shown in Figure 1. With reference to Note 2, add additional $\varnothing 0.129$ countersunk holes (Qty 2) per Detail A.
- 2.2 Increase the diameter of affected thru holes in D3391-013/-023 Mid Tube Assembly with a $\varnothing 0.375$ drill bit, as shown in Figure 1.
- 2.3 Touch up affected areas with chemical film material (Alodine 1200 or 1201) per MIL-C-5541.
- 2.4 Install MS21075L5 Nut Plate (Qty 10) using MS20601AD4W4 (Qty 12) in the six (6) most forward holes and MS20601AD4W9 (Qty 8) in the four (4) aft holes. It is acceptable to replace MS20601AD4 rivets with longer or shorter rivets as required.
- 2.5 Increase diameter of affected wearpad holes on D4095-043/-045 to $\varnothing 0.375$
- 2.6 Re-install D3391-015/-025 Aft Tube Assembly in accordance with ICA-D412-742 Section 32.9. Install D4095-043/-045 Wearshoes using AN5C7A Bolts (Qty 10) and NAS1149C0532R Washers (Qty 10) in locations corresponding to this modification.

A	NEW ISSUE	WM	15.11.27
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE USA, INC EUGENE, OR	
DRAWN	WM		
CHECKED	ASS	DRAWING NO.	REV. A
MFG. APPR.	NIA	DSI 9733	SHEET 1 OF 3
APPROVED	en	TITLE	SCALE
DE APPR.	en	SKIDTUBE INSERT REPAIR	NTS
DATE	15.11.27	COPYRIGHT © 2015 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


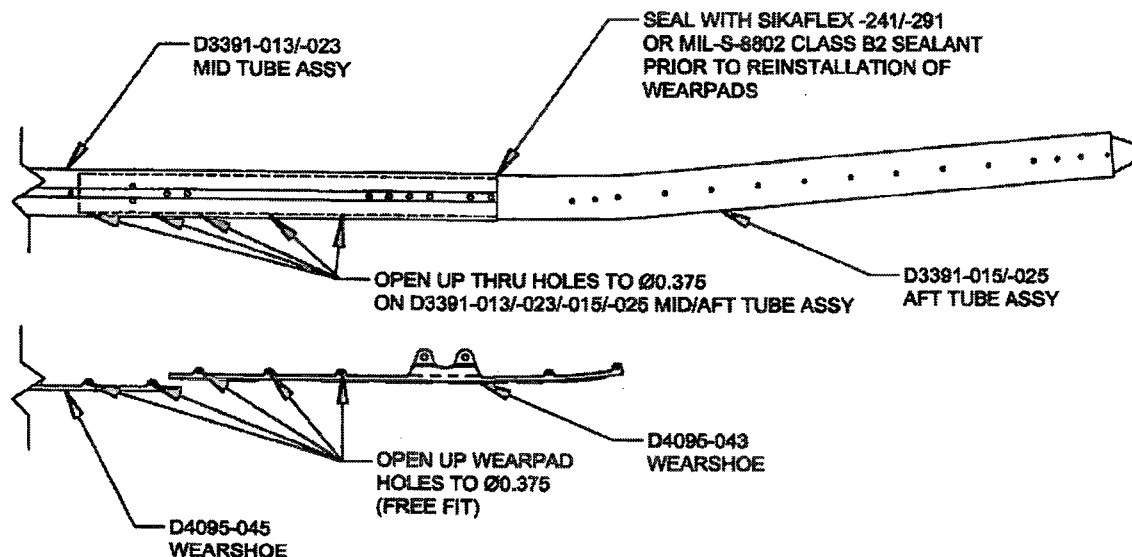


FIGURE 1 - AFFECTED LOCATIONS
(Aft section of D412-742-XXX Assy shown)

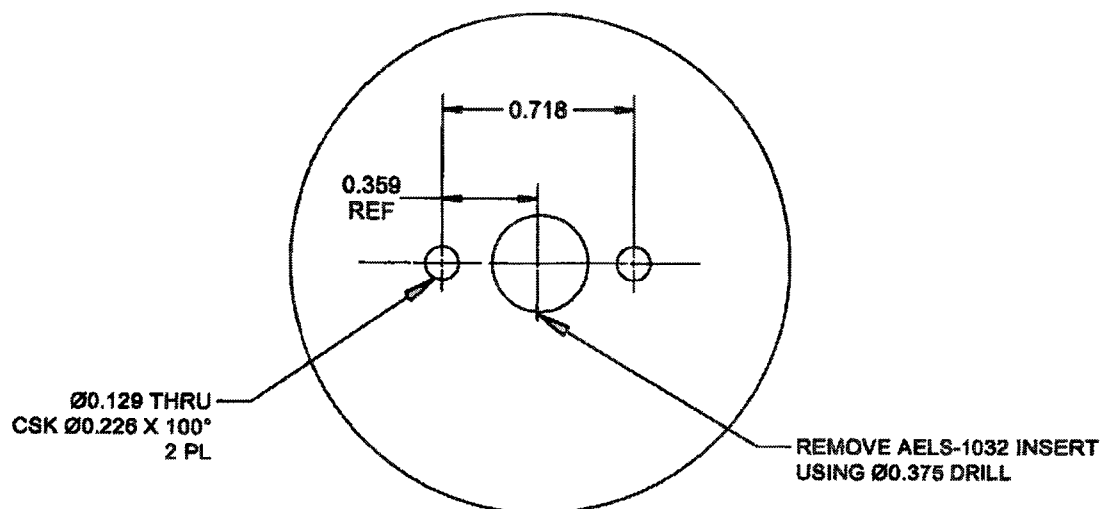

DETAIL A
(10 PLACES)

DESIGN	AP	DART AEROSPACE USA, INC EUGENE OREGON	
DRAWN	WM		
CHECKED	AS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9733	SHEET 2 OF 3
APPROVED	DN	TITLE	SCALE
DE APPR.	TH	SKIDTUBE INSERT REPAIR	NTS
DATE	15.11.27	COPYRIGHT © 2016 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

3.0 PARTS LIST

QTY -011	PART NUMBER	DESCRIPTION
10	DSI9733-011	SKIDTUBE REPAIR KIT
10	AN5C7A	BOLT
12	MS20801AD4W4	RIVET, BLIND
8	MS20801AD4W9	RIVET, BLIND
10	MS21075L5	NUT PLATE, FLOATING
10	NAS1149C0532R	WASHER

4.0 WEIGHT AND BALANCE

There is negligible weight and balance change associated with this modification.

DESIGN	AP	DART AEROSPACE USA, INC EUGENE, OR
DRAWN	WM	
CHECKED	ASS	DRAWING NO. REV. A
MFG. APPR.	N/A	DSI 9733 SHEET 3 OF 3
APPROVED	Q/M	TITLE SCALE
DE APPR.	CH	SKIDTUBE INSERT REPAIR NTS
DATE	15.11.27	COPYRIGHT © 2016 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS RELEASED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC

REFERENCE

3.0 PARTS LIST

QTY -011	PART NUMBER	DESCRIPTION
10	DSI0733-011	SKIDTUBE REPAIR KIT
10	AN5C7A	BOLT
12	MS20601AD4W4	RIVET, BLIND
8	MS20601AD4W9	RIVET, BLIND
10	MS21075L5	NUT PLATE, FLOATING
10	NAS1148C0532R	WASHER

4.0 WEIGHT AND BALANCE

There is negligible weight and balance change associated with this modification.

DESIGN	AP	DART AEROSPACE USA, INC EUGENE, OR	
DRAWN	WM		
CHECKED	ASS	DRAWING NO.	REV. A
MFG. APPR.	N/A	DSI 9733	SHEET 3 OF 3
APPROVED	DM	TITLE	SCALE
DE APPR.	SH	SKIDTUBE INSERT REPAIR	NTS
DATE	15.11.27	COPYRIGHT © 2016 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS RELEASED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	